



8.2 TEMPO ZERO POINT ADJUSTMENT




Jig

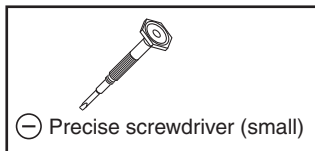


Adjustment and Check Points

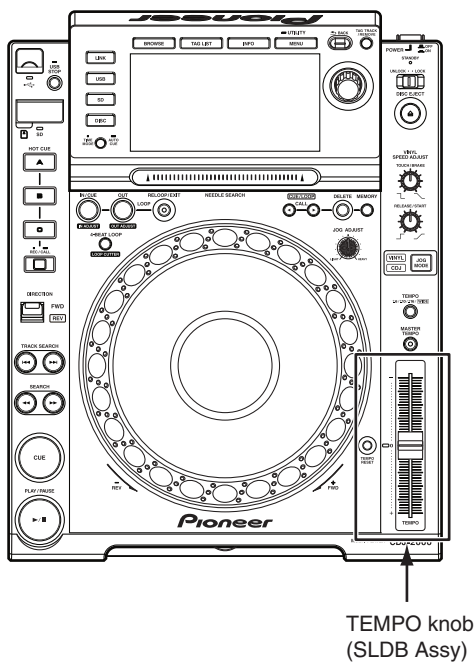

Zero Point ADJ.

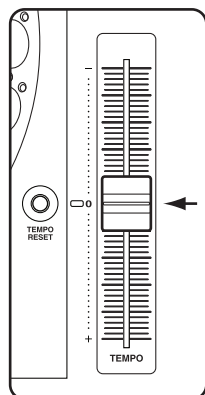

Set the TEMPO knob to the center "0" point.

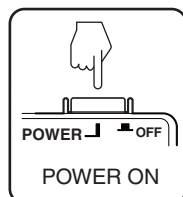

Necessary Adjustment Points

When

Exchange the SLIDER VR

Adjustment points

VR8702
(Zero Point ADJ.)

